


Excavation for new foundation to be done with low impact methods (Hydrovac at <500psi, airspade or hand dig) under supervision of ISA certified arborist who will prune roots as necessary.

Tree #8 is in hazardous condition and should be removed immediately.

Plant 6 replacement trees after construction is complete.

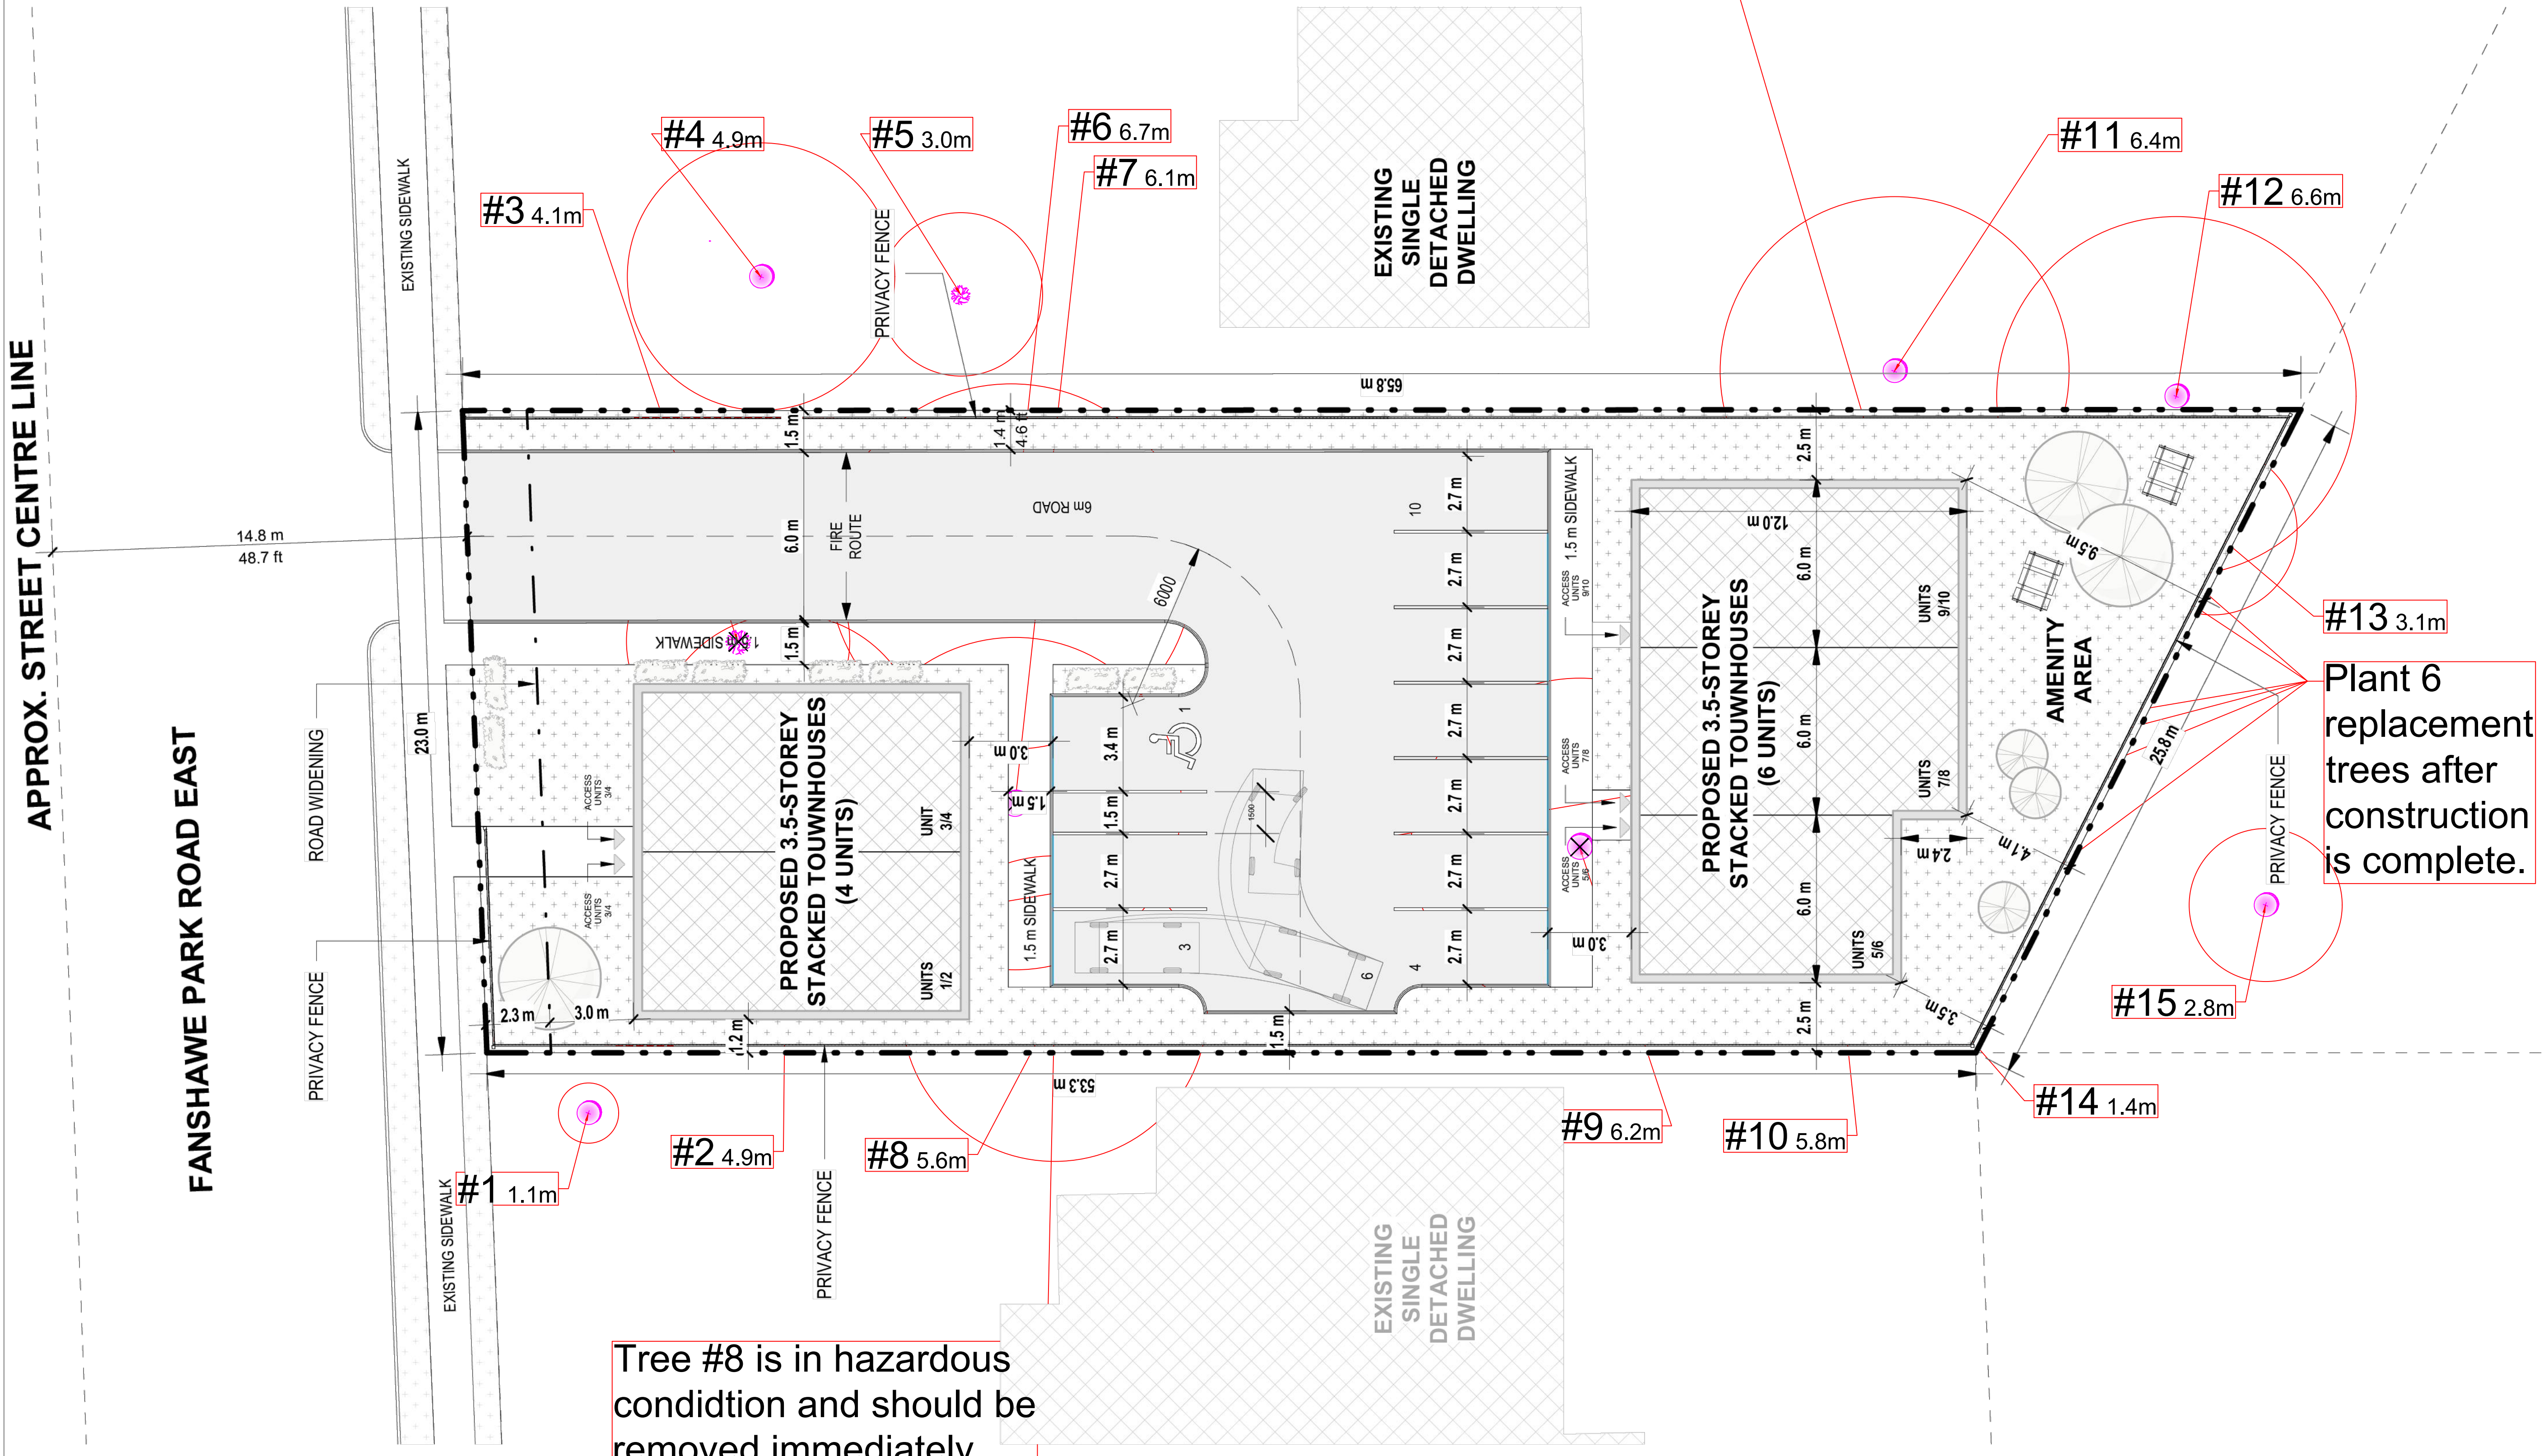

**NOTES:**

- All field data have been recorded by Clayton Gray ISA Certified Arborist® ON-2611A. All tree locations are based on the survey supplied by the client and field observation by the arborist.
- This plan shall be used in conjunction with the Tree Protection Action Key (TPAK). Specific information regarding tree species, condition, and protection protocols are listed therein.
- Refer to the Arborist Report prepared for this project for specific instruction regarding tree protection requirements.

**LEGEND**

- RETAINED TREE
- RETAINED CONIFEROUS TREE
- REMOVE TREE
- REMOVE CONIFEROUS TREE
- REPLACEMENT TREE
- RETAINED HEDGEROW
- TREE PROTECTION FENCE
- TREE PROTECTION ZONE

No.	DATE	BY	REVISIONS
1	03/06/24	CG	Tree Protection Plan

**DAVEY RESOURCE GROUP**  
A Division of The Davey Tree Expert Company

**TITLE:**  
Tree Protection Plan  
691 Fanshawe Park Rd E  
London, ON N5X 1L4

**CLIENT:**  
Greenstation Landscaping

<b>DRAWING NO.:</b> 001	<b>SCALE:</b> 1:75
<b>JOB NO.:</b>	<b>SHEET:</b> 1 OF 3

	Species	Botanical	DBH (cm) @ 1.4 m	Tree Ownership	Minimum Tree Protection Zone	Health	Structure	Overall Condition	Crown Width (m)	Deadwood (%)	Construction inside Min TPZ? (Y/N)	Impact: None, Low, Medium, High	Action	Permit Required? (Y/N)	Observations and Recommendations
1	London Plane Tree	<i>Platanus x. acerifolia</i>	11	City	1.1	Good	Good	Good	3	0	N	None	Preserve	N	
2	Norway Maple	<i>Acer platanoides</i>	49	Private	4.9	Good	Good	Good	8	5	N	None	Remove	N	
3	White Spruce	<i>Picea glauca</i>	41	Private	4.1	Poor	Fair	Poor	4	60	N	None	Remove	N	Declining
4	Honey Locust	<i>Gleditsia triacanthos</i>	49	Neighbour	4.9	Good	Good	Good	9	15	N	None	Preserve	N	
5	Norway Spruce	<i>Picea abies</i>	30	Neighbour	3.0	Good	Good	Good	5	0	N	None	Preserve	N	
6	Littleleaf Linden	<i>Tilia cordata</i>	67	Private	6.7	Good	Fair	Good	6	5	N	None	Remove	Y	
7	Littleleaf Linden	<i>Tilia cordata</i>	61	Private	6.1	Good	Fair	Fair	8	5	N	None	Remove	Y	
8	Sugar Maple	<i>Acer saccharum</i>	56	Private	5.6	Good	Poor	Poor	7	5	N	None	Remove	Y	Hazardous. Split forming at large inclusion in mainstem
9	Norway Maple	<i>Acer platanoides</i>	62	Private	6.2	Good	Fair	Good	9	10	N	None	Remove	Y	Large deadwood
10	Norway Maple	<i>Acer platanoides</i>	58	Private	5.8	Good	Good	Good	11	5	N	None	Remove	Y	
11	Norway Maple	<i>Acer platanoides</i>	64	Neighbour	6.4	Good	Fair	Good	12	5	N	None	Injure	Y	Estimated dbh
12	Sugar Maple	<i>Acer saccharum</i>	66	Neighbour	6.6	Good	Fair	Good	10	5	N	None	Preserve	N	3 stems (38cm x3) sum of squares used to determine dbh
13	Sugar Maple	<i>Acer saccharum</i>	31	Private	3.1	Good	Good	Good	5	0	N	None	Preserve	N	2 stems (31 and 12cm)
14	Eastern Redbud	<i>Cercis canadensis</i>	14	Private	1.4	Good	Good	Good	4	5	N	None	Remove	N	
15	Norway Maple	<i>Acer platanoides</i>	28	Neighbour	2.8	Good	Good	Good	8	5	N	None	Preserve	N	

NOTES:

- All field data have been recorded by Clayton Gray ISA Certified Arborist® ON-2611A. All tree locations are based on the survey supplied by the client and field observation by the arborist.
- This plan shall be used in conjunction with the Tree Protection Action Key (TPAK). Specific information regarding tree species, condition, and protection protocols are listed therein.
- Refer to the Arborist Report prepared for this project for specific instruction regarding tree protection requirements.

LEGEND

No.	DATE	BY	REVISIONS
1	03/06/24	CG	Tree Protection Plan




TITLE:  
Tree Protection Plan  
691 Fanshawe Park Rd E  
London, ON N5X 1L4

CLIENT:  
Greenstation Landscaping

DRAWING NO.: 001      SCALE:

JOB NO.:                      SHEET: 2 OF 3

## TREE PRESERVATION DETAILS

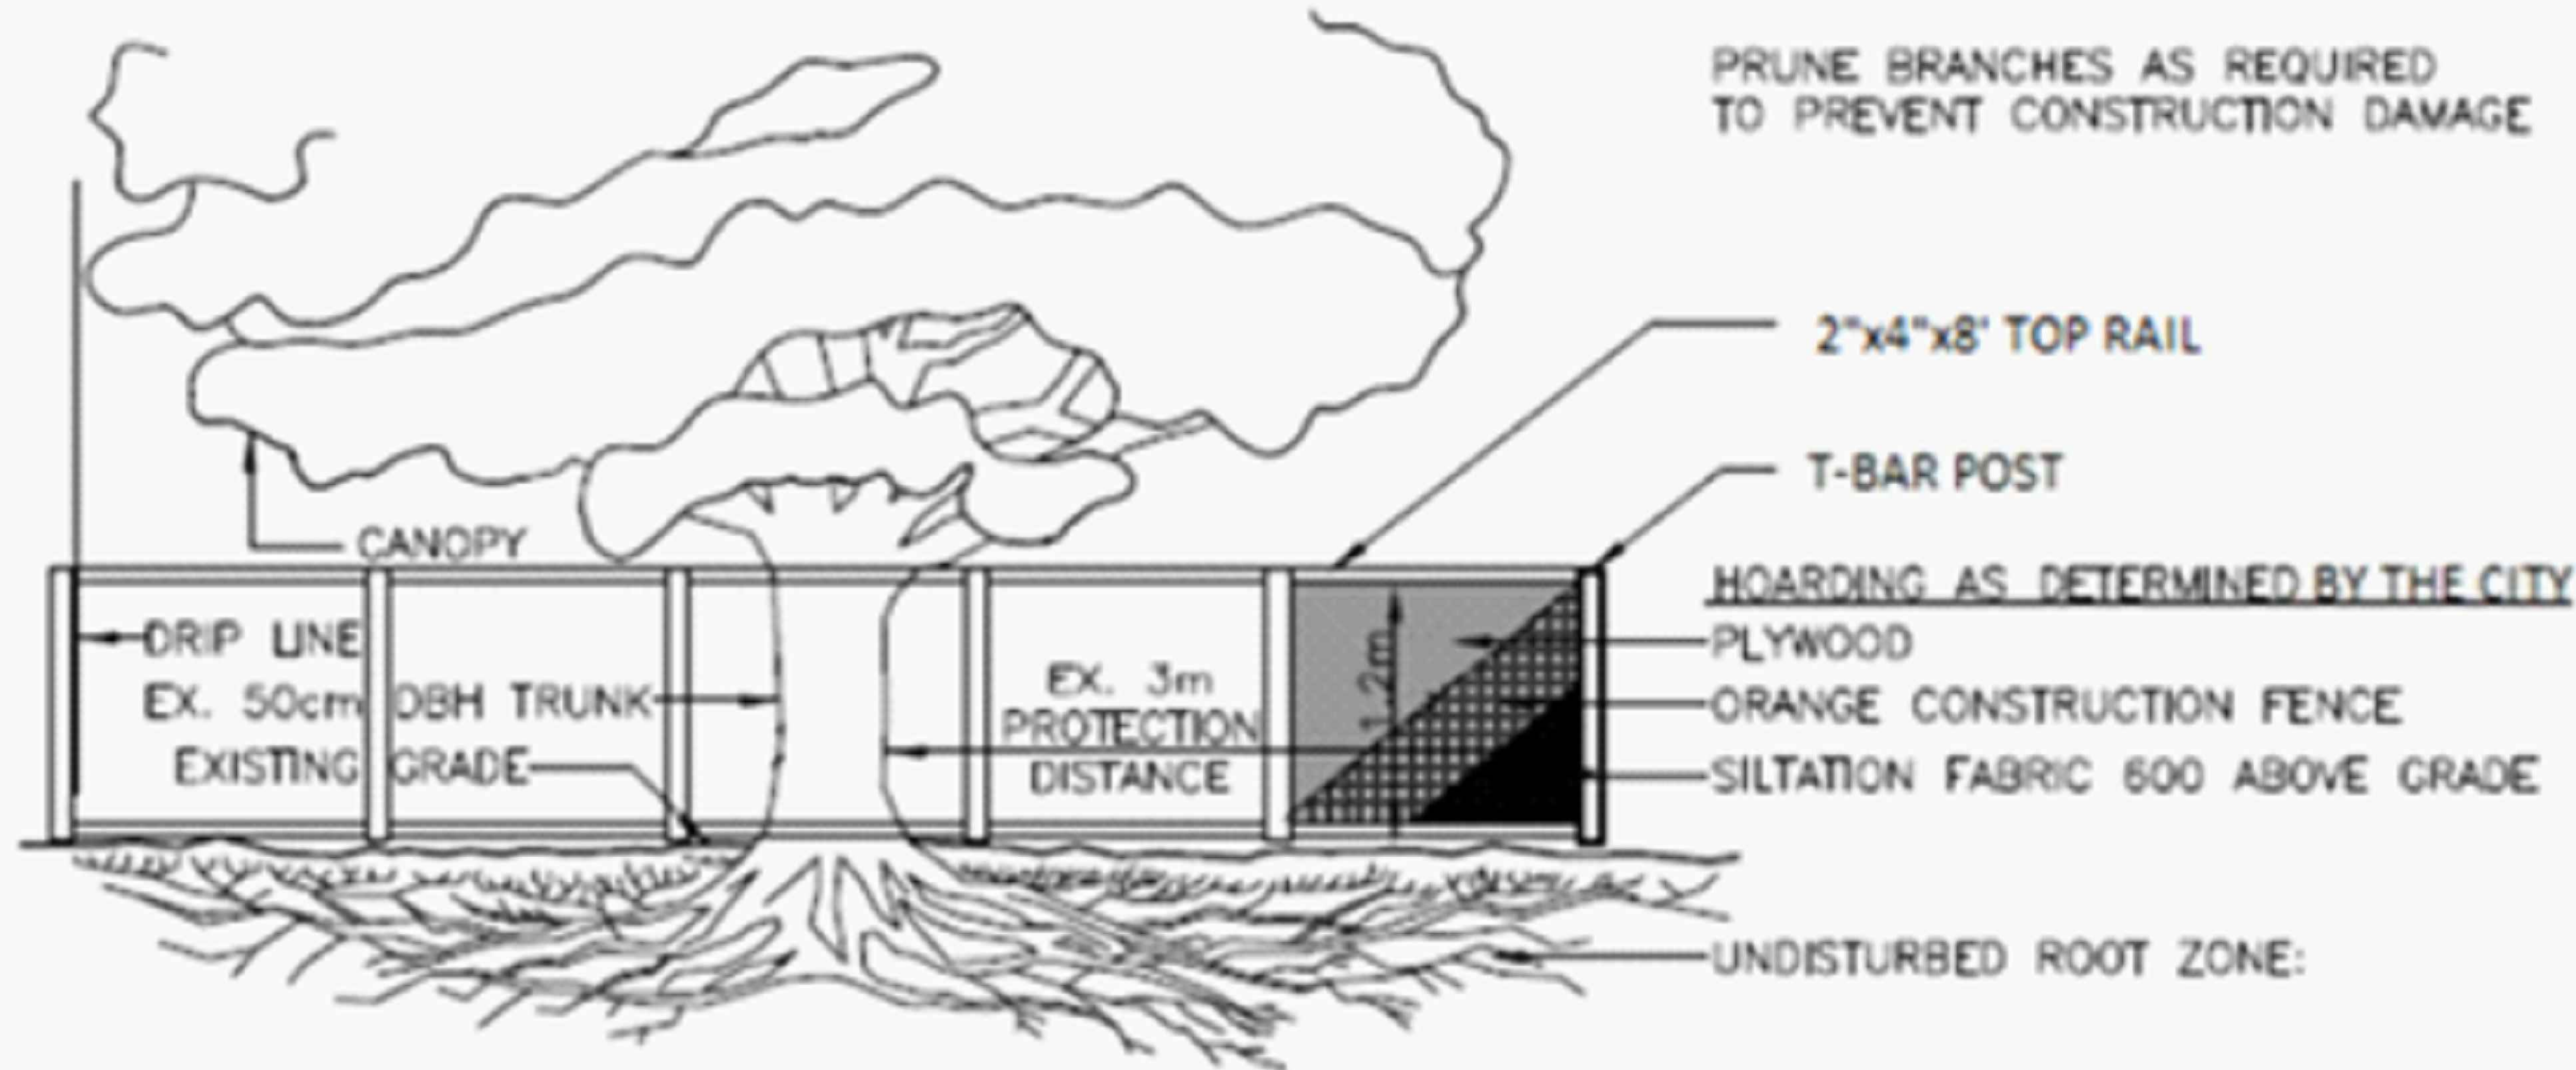


### NOTES:

- All field data have been recorded by Clayton Gray ISA Certified Arborist® ON-2611A. All tree locations are based on the survey supplied by the client and field observation by the arborist.
- This plan shall be used in conjunction with the Tree Protection Action Key (TPAK). Specific information regarding tree species, condition, and protection protocols are listed therein.
- Refer to the Arborist Report prepared for this project for specific instruction regarding tree protection requirements.

### LEGEND

No.	DATE	BY	REVISIONS
1	03/06/24	CG	Tree Protection Plan

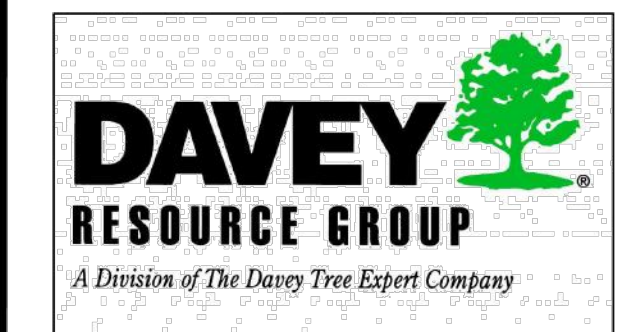

TITLE:  
Tree Protection Plan  
691 Fanshawe Park Rd E  
London, ON N5X 1L4

CLIENT:  
Greenstation Landscaping

DRAWING NO.:	001	SCALE:	
JOB NO.:		SHEET:	3 OF 3